N4917BACA 100G Optical Receiver Test Application

This document contains latest information on the Keysight N4917BACA 100G Optical Receiver Test Application.

Related Document

For detailed information, refer to the following document for this application:

- "Keysight_N4917BACA_UserGuide.pdf"

This document can be found at the following location after you install the application:

C:\Program Files\ Keysight\M8070B\Apps\N4917BACA\help

The M8070B documents can be located by clicking *Start > All Programs > Keysight M8070B > Keysight M8070B Documentation*. Alternatively, you can also visit

www.keysight.com/find/m8070b to find the latest versions of M8070B documents.





Installation Steps

To install the N4917BACA 100G Optical Receiver Test Application, perform the following steps:

- 1. Review the System Requirements for this application.
- 2. Download the installer file:
 - a. Go to the link: http://www.keysight.com/find/N4917BACA
 - b. Click the **Technical Support** link on the right side of this page.
 - c. Select the **Drivers**, Firmware & Software tab.
 - d. Click the N4917BACA 100G Optical Receiver Test link and download the installer file.
- 3. In case IO Libraries Suite is not installed on your machine, download it from http://www.keysight.com before you proceed to installation of the N4917BACA software.
- 4. Double-click the downloaded installer file on your PC.
- Please note that both Keysight License Manager 6 and Keysight License Manager 5 are installed on your system when you install N4917BACA software.
 When prompted, install Keysight License Manager, if the same is not already available on your computer.
- 6. Follow and respond to the installer prompts.
- 7. Accept the terms of the Keysight Software End-User License Agreement and click Next.
- 8. Click Install.
- 9. Click Finish to finish the installation and exit the installation wizard.
- 10. Install the required licenses via the Keysight License Manager (if not done before). To know about the required licenses, refer to the User Guide.



Getting Started

To access the installed N4917BACA application, perform the following steps:

- 1. From the **Start** menu of the Windows Operating System, select **All Programs** > **Keysight M8070B Applications** > **Launch Keysight N4917BACA**.
- If you are launching the Keysight N4917BACA application for the first time, the End-User License Agreement window appears. Select Agree to continue.
 The N4917BACA application banner is displayed.
- 3. If there is a single instance of the M8070B software running locally, the N4917BACA application launches after automatically getting connected to the M8070B software.
- 4. If the N4917BACA application does not detect any instance of the M8070B software running locally, the Connect to M8070 window appears.
- 5. When the application starts successfully, it will start with the default layout and will show the **Set Up** tab.

For more information on how to use the various features in the N4917BACA application, refer to the *Keysight N4917BACA 100G Optical Receiver Test Application Online Help*.



Keysight N4917BACA Software Version 2.5.3

| Release Date: | September 18, 2023 |
|--|--|
| File Name: | SetupM80RxIEEE100G02050003.exe |
| Operating System | Microsoft Windows 7, Windows 8, Windows 10, (64 bit) |
| Requirements Category (e.g., instrument software version): | Please see the product data sheet on keysight.com |
| License: | Please see the product data sheet on keysight.com |

New Features

- Added support for the following new transmission standards:
 - o 10GBASE-LR/-ER/-SR IEEE 802.3ae
 - o 40GBASE-LR4/-ER4/-SR4 IEEE 802.3ba
- Support for N7779C tunable lasers

Bug Fixes

- Fixed a defect that caused the software to stop with an exception when capturing the DCA stressed eye screenshot from a high-resolution monitor.
- Fixed a defect that inhibited the software from using the second internal laser source (1550nm) in the reference transmitter modules 8194xA.
- Fixed a defect in the calibration result PDF export.
- Fixed a defect in the calibration result CSV export.

Known Issues

- When opening the application's user guide in the Acrobat Reader PDF Viewer from within the N4917BACA application (Help → View Test Procedure), error pop-up messages have been observed in some cases. To view the PDF document in this case the, please follow one of the following workarounds:
 - Open the PDF document directly from with the Acrobat Reader application either by browsing to the installation location "c:\Program Files\Keysight\M8070B\Apps\N4917BACA\help\" or downloading the file from Keysight.com
 - o Change the default file viewer program for PDF files in Windows to a different software, as e.g., Microsoft Edge.



 Unexpected behavior might be observed when running the software and the software prerequisites on Windows 10 operating system. As a workaround, ensure that you install and run the N4917BACA application and the other software prerequisites as an administrator.

In scenarios where the user does not have administrator rights, the suggested workaround is to install the software and prerequisites as an administrator and enable full control (read, write access) **mandatorily** to the following folders:

- o C:\Program Files\Keysight\M8070B\Apps\N4917BACA
- o C:\ProgramData\Keysight\M8070B\Apps\N4917BACA
- C:\ProgramData\Microsoft\Windows\Start Menu\Programs\Keysight M8070B Applications
- o C:\Users\Public\Documents\Keysight\M8070B\Apps\N4917BACA

and preferably to the following additional folder:

- o C:\Users\<user_name>\Documents\Keysight\M8070B\Apps\N4917BACA
- Saved projects files from previous versions (< 2.0.0) cannot be opened anymore due to the change of the application title. To re-enable opening these projects files, the tags "Application name" in the main project file (*.proj) and compliance file (compliance.lim) in the project directory must be modified manually and should read the actual application name (see application window or name in project file saved with latest version).
- When an appended series of calibrations fail during the first trial, the results of successive trials will not be displayed in the Results tab even if these calibrations were successful.
 Restart the series in this case or use "Replace results" to overwrite the results of the previous runs.
- Depending on the targeted standard and particular HW configuration, a 6dB or 10dB attenuator might be required in the sinusoidal interference signal path. Use this approach when the calibration fails, and an error related to clipping of AWG amplitude is reported (Error message: Set range clipped).
- The TDEC verified by the software and the one displayed in eye-mode measurement of the FlexDCA software using default parameters are based on different OMA definitions, resulting in different TDEC values in presence of strong ISI. The value reported by the N4917BACA software is measured compliant to the method defined in the standards.
- In some of the scenarios that involve the use of an external CDR for transmission standards where its usage is optional, calibrations might lead to failing results.
- Laser safety errors are sometimes returned when the reference transmitter is calibrated, and an external TLS source is used. As a workaround restart the test task or reduce the maximum output power of the tunable laser ("Maximum TLS output Power" parameter in the Configure tab). Alternatively, toggle the "Switch off PG during REFTX recal" parameter in the Configure tab.



- When the Keysight N77xx Viewer software is connected via USB to a N77xx type attenuator which is also used by the N4917BACA application, time-out errors might occur.
 To prevent these errors during ORST testing, disconnect the N77xx Viewer software from the attenuator.
- In some non-EN-US locales, commas might be the preferred decimal mark instead of the decimal point. Similarly, use of digit group separators might be preferred in some locales. This might lead to misinterpretation of locale-specific formats when working with numeric values. While the N4917BACA application has some validation mechanisms to check for any confusion arising out of the non EN-US formats, it is best to avoid the use of locale-specific formats. Thus, use "point" as the decimal mark and avoid use of digit group separators.

Please contact Keysight Technical Support (www.keysight.com/find/supportrequest) if you encounter any other issue.



Keysight N4917BACA Software Version 02.00.0050

| Release Date: | April 05, 2023 |
|---------------|---|
| File Name: | SetupM80RxIEEE100G02000050.exe |
| License: | Please see the product data sheet on keysight.com |

The system requirements for the N4917BACA application remain the same as for the previous release. See system requirements.

Modification

- Update with Keysight License Manager 5

Known Issues

- See Known Issues.

Keysight N4917BACA Software Version 02.00.0020

| Release Date: | August 01, 2022 |
|---------------|---|
| File Name: | SetupM80RxIEEE100G02000020.exe |
| License: | Please see the product data sheet on keysight.com |

The system requirements for the N4917BACA application remain the same as for the previous release. See system requirements.

Fixed Issues

- Fixed a defect that caused TDEC measurements to abort due to an incompatibility with the modified TDEC measurement algorithm introduced in FlexDCA version A.06.90 or newer.

Known Issues

- See Known Issues.



Keysight N4917BACA Software Version 02.00.0011

| Release Date: | January 14, 2022 |
|---------------|---|
| File Name: | SetupM80RxIEEE100G02000011.exe |
| License: | Please see the product data sheet on keysight.com |

The system requirements for the N4917BACA application remain the same as for the previous release. See system requirements.

Fixed Issues

- Fixed a critical defect that caused the software to abort the receiver tests when using an external clock recovery (CDR), due to a SCPI error.
- Adjusted the notation of measurement units in the results tables (added spaces between the result value and unit in some cases).
- Fixed a defect that caused the software to not update some standard settings when loading a saved project file or restoring the project settings after an unexpected software crash.

Enhancements

- Support for the internal clock recovery available in newer M8046A error detector modules (requires corresponding license option).

Known Issues

- See Known Issues.

Keysight N4917BACA Software Version 02.00.0005

| Release Date: | January 19, 2021 |
|---------------|---|
| File Name: | SetupM80RxIEEE100G02000005.exe |
| License: | Please see the product data sheet on keysight.com |

The system requirements for the N4917BACA application remain the same as for the previous release. See system requirements.



Fixed Issues

- class tunable laser as optical source.
- Fixed a defect that would cause the stress signal calibration to abort while generating the noise interference pattern for PSM4 transmission standard in certain instrument configurations.

Known Issues

- See Known Issues.

Keysight N4917BACA Software Version 02.00.0001

| Release Date | November 9, 2020 |
|--|---|
| Operating System | Microsoft Windows 7 (64 bit) |
| | Microsoft Windows 8 (64 bit) |
| | Microsoft Windows 10 (64 bit) |
| Memory | 8 GB RAM [minimum] |
| Display resolution | WXGA+ (1440 x 900) [minimum] |
| PC Interfaces | USB LAN GPIB (optional) |
| Instrument Firmware | M8040A BERT - M8070A/B System Software. For the supported versions see the <i>Software Pre-requisites</i> row. |
| | DCA-M/DCA-X - FlexDCA version A.06.60.378 or later |
| | 8164B LMS - Ver.V5.25 or later |
| BERT | M8040A-BU2 mainframe with USB option |
| | M8070A-0TP/ONP/1TP/1NP System Software. For the complete list of licenses, see Chapter 2 of the User Guide. |
| | M8045A-G32/0G3/0G4/801 High Performance BERT module |
| | M8057A/B Remote head for M8045A pattern generator, 1 channel |
| | M8046A-A32/801 Analyzer module |
| Signal Generator for Sinusoidal and Gaussian Noise Interference | M8195A-002/16G Arbitrary Waveform Generator or M8196A-002 Arbitrary Waveform Generator or |



| | 044504 004 B L 5 L 4 L 4 L 4 L 4 L 4 L 4 L 4 L 4 L 4 |
|------------------------------|--|
| | 81150A-001 Pulse Function Arbitrary Noise Generator or |
| | 81160A-001 Pulse Function Arbitrary Generator |
| | N5171B-503 EXG X-series RF Analog Signal |
| | Generator |
| | N5172B EXG X-Series RF Vector Signal Generator |
| | M8054A Interference Source, 32 GHz |
| Lightwave Measurement System | 8164B LMS Mainframe |
| | Tunable lasers |
| | N7776C Tunable Laser 1240-1380 nm or |
| | N7778C Tunable Laser 1240-1380 nm or |
| | 81602A-013 Tunable Laser 1250-1370 nm or |
| | 81606A-113 Tunable Laser 1240-1380 nm or |
| | 81608A-113 Tunable Laser 1240-1380 nm or |
| | 81609A-113 Tunable Laser 1240-1380 nm |
| | Reference Transmitters |
| | 81490A-E05 Reference Transmitter or |
| | 81490A-E09 Reference Transmitter or |
| | |
| | 81490A-E10 Reference Transmitter (multimode – for SR only) |
| | 81491A-085 Reference Transmitter (multimode - for SR only) |
| | 81491A-135 Reference Transmitter |
| | 81492A-E01 Reference Transmitter (56GBaud) |
| | 81492A-135 Reference Transmitter (56GBaud) |
| | 81000FI Optical Connector Interface |
| | 81000NI Optical Connector Interface |
| | Optical attenuators: |
| | 81576A Attenuator module (straight SMF) or |
| | 81577A Attenuator module (angled SMF) or |
| | N7761A external Attenuator (1 ch straight SMF) or |
| | N7762A external Attenuator (2 ch straight SMF) or |
| | N7764A external Attenuator (4 ch straight SMF) |
| | N7751A external Attenuator (1 ch with 2 optical |
| | power meter channels, SMF) |



| | N7752A external Attenuator (2 ch with 2 optical |
|-------------------------|---|
| | power meter channels, SMF) |
| | N7766A Optical Attenuator for Multimode Fiber |
| | (2ch) |
| | N7768A Optical Attenuator for Multimode Fiber (4ch) |
| DCA-X Oscilloscope | N1000A DCA-X Wide-Bandwidth mainframe |
| | 86100D-ETR/PTB/200/201/300/401 DCA-X mainframe |
| | N1030A/B Optical plug-in module for the N1000A DCA-X mainframe |
| | 86105D-281/IRC Electrical/Optical SMF module or 86115D-282 /IRC Dual Optical SMF module |
| | 86107A-020 Precision Time Base (not required, if DCA-X has the option -PTB) |
| | 86115D-282/IRC |
| | Because of their low noise and superior speed, it is recommended to use DCA-M series oscilloscopes instead of DCA-X series oscilloscopes. |
| DCA-M Oscilloscope | N1092A one optical channel or |
| | N1092B two optical channels or |
| | N1092C one optical, two electrical channels or |
| | N1092D four optical channels or |
| | N1092E two optical, two electrical channels |
| | options LOJ/PLK/IRC/200/201/300/401/500 |
| Clock Recovery | N1077A-232/SMS/JSA Optical/Electrical Clock Recovery |
| Software Pre-requisites | Keysight IO Library rev. 18.1 or above |
| | M8070B system software for M8000 series ver. 7.2.40.2 or later and |
| | M8070ADVB Advanced Measurement Package for M8000 series ver. 1.3.200.4 |
| | N1010A FlexDCA Remote Access System A.06.60.378 or later |
| | In the newer releases of FlexDCA, analysis packages that combine many separate items that were available previously under individual licenses are now available. Refer to the Data Sheet to see |



| License: | Please see the product data sheet on keysight.com |
|--------------------------|---|
| File Name | SetupM80RxIEEE100G02000001.exe |
| | Keysight N4917BACA 100G Optical Receiver Test Application. For the required licenses, see User Guide. |
| | Keysight M8046A with options A32 or A64; 801 |
| | Keysight M8045A with options G32 or G64; 0G3 or UG3; 0G4 or UG4; 801 |
| Application Requirements | Keysight M8070B System Software. For the required licenses, see User Guide. |
| | N1010A-TFP (TDECQ Transmitter and Dispersion Eye Closure for PAM4) |
| | N1010A-9FP (PAM-N Analysis Software) |
| | Alternatively, use the older licenses: |
| | N1010100A R&D Package |
| | package: |
| | Application, you require the following analysis |
| | N4917BSCB 400G Optical Receiver Test |
| | into the more recent FlexDCA packages. For the |
| | how features of previous FlexDCA releases map |

Fixed Issues

 Fixed a defect because of which the M8054A interference source output amplifier was not being turned on, when recalling the instrument settings from a previously stored stressed eye calibration. The output amplifier is now turned on, as expected (observable in M8070 GUI), resulting in a correctly impaired stress signal.

Known Issues

 Unexpected behavior might be observed when running the software and the software prerequisites on Windows 10 operating system. As a workaround, ensure that you install and run the N4917BACA application and the other software prerequisites as an administrator.

In scenarios where the user does not have administrator rights, the suggested workaround is to install the software and prerequisites as an administrator and enable full control (read, write access) **mandatorily** to the following folders:

- o C:\Program Files\Keysight\M8070A\Apps\N4917BACA
- $o \quad C: \label{lem:condition} C: \label{lem:c$



- C:\ProgramData\Microsoft\Windows\Start Menu\Programs\Keysight M8070A Applications
- o C:\Users\Public\Documents\Keysight\M8070A\Apps\N4917BACA

and preferably to the following additional folders:

- o C:\Users\<user_name>\Documents\Keysight\M8070A\Apps\N4917BACA
- o C:\Users\<user_name>\Documents\Keysight\M8070A\Apps\N4917BACA
- Saved projects files from previous versions (< 2.0.0) cannot be opened anymore due to the change of the application title. To re-enable opening these projects files, the tags "Application name" in the main project file (*.proj) and compliance file (compliance.lim) in the project directory must be modified manually and should read the actual application name (see application window or name in project file saved with latest version).
- When an appended series of calibrations fail during the first trial, the results of successive trials will not be displayed in the Results tab even if these calibrations were successful.
 Restart the series in this case or use "Replace results" to overwrite the results of the previous runs.
- Depending on the targeted standard and particular HW configuration, a 6dB or 10dB attenuator might be required in the sinusoidal interference signal path. Use this approach when the calibration fails, and an error related to clipping of AWG amplitude is reported (Error message: Set range clipped).
- The TDEC verified by the software and the one displayed in eye-mode measurement of the FlexDCA software using default parameters are based on different OMA definitions, resulting in different TDEC values in presence of strong ISI. The value reported by the N4917BACA software is measured compliant to the method defined in the standards.
- In some of the scenarios that involve the use of an external CDR for transmission standards where its usage is optional, calibrations might lead to failing results.
- Laser safety errors are sometimes returned when the reference transmitter is calibrated, and an external TLS source is used. As a workaround restart the test task or reduce the maximum output power of the tunable laser ("Maximum TLS output Power" parameter in the Configure tab). Alternatively, toggle the "Switch off PG during REFTX recal" parameter in the Configure tab.
- When the Keysight N77xx Viewer software is connected via USB to a N77xx type attenuator which is also used by the N4917BACA application, time-out errors might occur.
 To prevent these errors during ORST testing, disconnect the N77xx Viewer software from the attenuator.
- In some non-EN-US locales, commas might be the preferred decimal mark instead of the decimal point. Similarly, use of digit group separators might be preferred in some locales. This might lead to misinterpretation of locale-specific formats when working with numeric values. While the N4917BACA application has some validation mechanisms to check for any confusion arising out of the non EN-US formats, it is best to avoid the use of locale-



specific formats. Thus, use "point" as the decimal mark and avoid use of digit group separators.

Please contact Keysight Technical Support (www.keysight.com/find/supportrequest) if you encounter any other issue.

Keysight N4917BACA Software Version 02.00.0000

| Release Date | October 9, 2020 |
|--|--|
| Operating System | Microsoft Windows 7 (64 bit) |
| | Microsoft Windows 8 (64 bit) |
| | Microsoft Windows 10 (64 bit) |
| Memory | 8 GB RAM [minimum] |
| Display resolution | WXGA+ (1440 x 900) [minimum] |
| PC Interfaces | USB |
| | LAN |
| | GPIB (optional) |
| Instrument Firmware | M8040A BERT - M8070A/B System Software. For |
| | the supported versions see the Software Pre- |
| | requisites row. |
| | DCA-M/DCA-X - FlexDCA version A.06.60.378 or |
| | later |
| | 8164B LMS - Ver.V5.25 or later |
| BERT | M8040A-BU2 mainframe with USB option |
| | M8070A-0TP/ONP/1TP/1NP System Software. For |
| | the complete list of licenses, see Chapter 2 of the |
| | User Guide. |
| | M8045A-G32/0G3/0G4/801 High Performance BERT module |
| | M8057A/B Remote head for M8045A pattern |
| | generator, 1 channel |
| | M8046A-A32/801 Analyzer module |
| Signal Generator for Sinusoidal and Gaussian Noise | M8195A-002/16G Arbitrary Waveform Generator or |
| Interference | M8196A-002 Arbitrary Waveform Generator or |
| | 81150A-001 Pulse Function Arbitrary Noise |
| | Generator or |
| | 81160A-001 Pulse Function Arbitrary Generator |



| | N5171B-503 EXG X-series RF Analog Signal Generator |
|------------------------------|--|
| | N5172B EXG X-Series RF Vector Signal Generator |
| | M8054A Interference Source, 32 GHz |
| Lightwave Measurement System | 8164B LMS Mainframe |
| | Tunable lasers |
| | N7776C Tunable Laser 1240-1380 nm or |
| | N7778C Tunable Laser 1240-1380 nm or |
| | 81602A-013 Tunable Laser 1250-1370 nm or |
| | 81606A-113 Tunable Laser 1240-1380 nm or |
| | 81608A-113 Tunable Laser 1240-1380 nm or |
| | 81609A-113 Tunable Laser 1240-1380 nm |
| | Reference Transmitters |
| | 81490A-E05 Reference Transmitter or |
| | 81490A-E09 Reference Transmitter or |
| | 81490A-E10 Reference Transmitter (multimode – for SR only) |
| | 81491A-085 Reference Transmitter (multimode - for SR only) |
| | 81491A-135 Reference Transmitter |
| | 81492A-E01 Reference Transmitter (56GBaud) |
| | 81492A-135 Reference Transmitter (56GBaud) |
| | 81000FI Optical Connector Interface |
| | 81000NI Optical Connector Interface |
| | Optical attenuators: |
| | 81576A Attenuator module (straight SMF) or |
| | 81577A Attenuator module (angled SMF) or |
| | N7761A external Attenuator (1 ch straight SMF) or |
| | N7762A external Attenuator (2 ch straight SMF) or |
| | N7764A external Attenuator (4 ch straight SMF) |
| | N7751A external Attenuator (1 ch with 2 optical power meter channels, SMF) |
| | N7752A external Attenuator (2 ch with 2 optical power meter channels, SMF) |
| | N7766A Optical Attenuator for Multimode Fiber (2ch) |



| | N7768A Optical Attenuator for Multimode Fiber (4ch) |
|-------------------------|--|
| DCA-X Oscilloscope | N1000A DCA-X Wide-Bandwidth mainframe 86100D-ETR/PTB/200/201/300/401 DCA-X mainframe |
| | N1030A/B Optical plug-in module for the N1000A DCA-X mainframe |
| | 86105D-281/IRC Electrical/Optical SMF module or 86115D-282 /IRC Dual Optical SMF module |
| | 86107A-020 Precision Time Base (not required, if DCA-X has the option -PTB) |
| | 86115D-282/IRC Because of their low noise and superior speed, it is recommended to use DCA-M series oscilloscopes instead of DCA-X series oscilloscopes. |
| DCA-M Oscilloscope | N1092A one optical channel or |
| | N1092B two optical channels or |
| | N1092C one optical, two electrical channels or |
| | N1092D four optical channels or |
| | N1092E two optical, two electrical channels |
| | options LOJ/PLK/IRC/200/201/300/401/500 |
| Clock Recovery | N1077A-232/SMS/JSA Optical/Electrical Clock Recovery |
| Software Pre-requisites | Keysight IO Library rev. 18.1 or above |
| | M8070B system software for M8000 series ver. 7.2.40.2 or later and |
| | M8070ADVB Advanced Measurement Package for M8000 series ver. 1.3.200.4 |
| | N1010A FlexDCA Remote Access System A.06.60.378 or later |
| | In the newer releases of FlexDCA, analysis packages that combine many separate items that were available previously under individual licenses are now available. Refer to the Data Sheet to see how features of previous FlexDCA releases map into the more recent FlexDCA packages. For the N4917BSCB 400G Optical Receiver Test Application, you require the following analysis package: |



| | N1010100A R&D Package |
|--------------------------|---|
| | |
| | Alternatively, use the older licenses: |
| | N1010A-9FP (PAM-N Analysis Software) |
| | N1010A-TFP (TDECQ Transmitter and Dispersion Eye Closure for PAM4) |
| Application Deswirements | <u> </u> |
| Application Requirements | Keysight M8070B System Software. For the required licenses, see User Guide. |
| | Keysight M8045A with options G32 or G64; 0G3 or UG3; 0G4 or UG4; 801 |
| | Keysight M8046A with options A32 or A64; 801 |
| | Keysight N4917BACA 100G Optical Receiver Test Application. For the required licenses, see User Guide. |
| File Name | SetupM80RxIEEE100G02000000.exe |
| License: | Please see the product data sheet on keysight.com |

Enhancements

- Support for automated optical stressed receiver sensitivity test for optical transceivers compliance with the following IEEE 802.3 2015 MSA standard:
 - o 100GBASE-PSM4
- Support for the more recent Keysight tunable laser sources:
 - o N7776C Tunable Laser 1240-1380 nm
 - o N7778C Tunable Laser 1240-1380 nm
- Support for the N1030A/B Optical plug-in modules for the N1000A DCA-X mainframe.
- Support for the following new Interference source for sinusoidal interference and random interference in all the supported measurement flavors:
 - o M8054A Interference Source, 32 GHz
- Support for new firmware versions
 - o M8070B 7.2.40.2
 - M8070ADVB Advanced Measurement Package for M8000 Series 1.3.200.4
 - o FlexDCA A.06.60.378
 - o M8195A SFP 4.0.0.0
- Added the following new configuration variables:
 - o Force Multichannel Attenuator Reset By default, this configuration variable is set to "false", which means that if you reset or turn off one channel of the connected multichannel attenuator, it does not cause a reset or turning off of the remaining



channels.

If set to "true", a reset or turning off of one channel will reset/turn off all the channels in the multichannel attenuator.

- o Noise Interferer Amplitude Amplitude of the noise interferer component (rms value)
- Noise Interferer Lower Frequency Specifies the lowest frequency of the noise interferer component.
- Noise Interferer Higher Frequency Specifies the highest frequency of the noise interferer component.
- o Noise Interferer Crest Factor Specifies the crest factor of the noise interferer component, i.e., the ratio of the peak value to the standard deviation.
- o REFTX Recalibration Threshold Specifies the threshold level that triggers an REFTX recalibration when measured TCH value is below the specified value.
- o PSM4 jitter type Selects the jitter type (BUJ or PJ2) used for stress signal calibration.

Fixed Issues

- Fixed the earlier behavior of the application causing all the channel of a connected multichannel attenuator to get reset or turned off when one channel was reset or turned off. A new configuration variable has been added for this.
- Enabled the application to run without a connected error detector module and without M8070ADVB license when these are not required, e.g., when running a stressed eye calibration.
- The software now performs a check for the availability of the M8070ADVB package for M8070B and a valid license for using it, at the time of startup. This package is required for External CDR control, Jitter tolerance testing, and DUT control interface (DCI).
- The Error Detector Compare Mode configuration variable now supports the following three values for the correct handling of M8046A error detector module:
 - o Differential
 - o Single Ended Normal
 - Single Ended Complement

Known Issues

 Unexpected behavior might be observed when running the software and the software prerequisites on Windows 10 operating system. As a workaround, ensure that you install and run the N4917BACA application and the other software prerequisites as an administrator.

In scenarios where the user does not have administrator rights, the suggested workaround is to install the software and prerequisites as an administrator and enable full control (read, write access) **mandatorily** to the following folders:



- o C:\Program Files\Keysight\M8070A\Apps\N4917BACA
- o C:\ProgramData\Keysight\M8070A\Apps\N4917BACA
- C:\ProgramData\Microsoft\Windows\Start Menu\Programs\Keysight M8070A Applications
- o C:\Users\Public\Documents\Keysight\M8070A\Apps\N4917BACA

and **preferably** to the following additional folders:

- o C:\Users\<user_name>\Documents\Keysight\M8070A\Apps\N4917BACA
- o C:\Users\<user_name>\Documents\Keysight\M8070A\Apps\N4917BACA
- Saved projects files from previous versions (< 2.0.0) cannot be opened anymore due to the change of the application name. To re-enable opening these projects files, the tags "Application name" in the main project file (*.proj) and compliance file (compliance.lim) in the project directory must be modified manually and should read the actual application name (see application window or name in project file saved with latest version).
- When an appended series of calibrations fail during the first trial, the results of successive trials will not be displayed in the *Results* tab even if these calibrations were successful.
 Restart the series in this case or use "Replace results" to overwrite the results of the previous runs.
- Depending on the targeted standard and particular HW configuration, a 6dB or 10dB attenuator might be required in the sinusoidal interference signal path. Use this approach when the calibration fails, and an error related to clipping of AWG amplitude is reported (Error message: Set range clipped).
- The TDEC verified by the software and the one displayed in eye-mode measurement of the FlexDCA software using default parameters are based on different OMA definitions, resulting in different TDEC values in presence of strong ISI. The value reported by the N4917BACA software is measured compliant to the method defined in the standards.
- In some of the scenarios that involve the use of an external CDR for transmission standards where its usage is optional, calibrations might lead to failing results.
- Laser safety errors are sometimes returned when the reference transmitter is calibrated, and an external TLS source is used. As a workaround restart the test task or reduce the maximum output power of the tunable laser ("Maximum TLS output Power" parameter in the Configure tab). Alternatively, toggle the "Switch off PG during REFTX recal" parameter in the Configure tab.
- When the Keysight N77xx Viewer software is connected via USB to a N77xx type
 attenuator which is also used by the N4917BACA application, time-out errors might occur.
 To prevent these errors during ORST testing, disconnect the N77xx Viewer software from
 the attenuator.
- In some non-EN-US locales, commas might be the preferred decimal mark instead of the decimal point. Similarly, use of digit group separators might be preferred in some locales.
 This might lead to misinterpretation of locale-specific formats when working with numeric



values. While the N4917BACA application has some validation mechanisms to check for any confusion arising out of the non EN-US formats, it is best to avoid the use of locale-specific formats. Thus, use "point" as the decimal mark and avoid use of digit group separators.

Please contact Keysight Technical Support (www.keysight.com/find/supportrequest) if you encounter any other issue.

Keysight N4917BACA Software Version 01.50.0003

| Release Date | February 14, 2019 |
|--|---|
| Operating System | Microsoft Windows 7 (64 bit) |
| | Microsoft Windows 8 (64 bit) |
| | Microsoft Windows 10 (64 bit) |
| Memory | 8 GB RAM [minimum] |
| Display resolution | WXGA+ (1440 x 900) [minimum] |
| PC Interfaces | USB |
| | LAN |
| | GPIB (optional) |
| Instrument Firmware | M8040A BERT - M8070A/B System Software. For |
| | the supported versions see the Software Pre- |
| | requisites row. |
| | DCA-M/DCA-X - FlexDCA version A.06.01.68 or later |
| | 8164B LMS - Ver.V5.25 or later |
| DEDT | |
| BERT | M8040A-BU2 mainframe with USB option |
| | M8070A-0TP/ONP/1TP/1NP System Software. For |
| | the complete list of licenses, see Chapter 2 of the User Guide. |
| | M8045A-G32/0G3/0G4/801 High Performance BERT module |
| | M8057A Remote head for M8045A pattern |
| | generator, 1 channel |
| | M8046A-A32/801 Analyzer module |
| Signal Generator for Sinusoidal and Gaussian Noise Interference | M8195A-002/16G Arbitrary Waveform Generator or |
| | M8196A-002 Arbitrary Waveform Generator or |
| | 81150A-001 Pulse Function Arbitrary Noise |
| | Generator or |



| | 81160A-001 Pulse Function Arbitrary Generator |
|------------------------------|--|
| | N5171B-503 EXG X-series RF Analog Signal Generator |
| Lightwave Measurement System | 8164B LMS Mainframe |
| | Tunable lasers |
| | 81602A-013 Tunable Laser 1250-1370 nm or |
| | 81606A-113 Tunable Laser 1240-1380 nm or |
| | 81608A-113 Tunable Laser 1240-1380 nm or |
| | 81609A-113 Tunable Laser 1240-1380 nm |
| | Reference Transmitters |
| | 81490A-E05 Reference Transmitter or |
| | 81490A-E09 Reference Transmitter or |
| | 81490A-E10 Reference Transmitter (multimode – for SR only) |
| | 81491A-085 Reference Transmitter (multimode - for SR only) |
| | 81491A-135 Reference Transmitter |
| | 81492A-E01 Reference Transmitter (56GBaud) |
| | 81000FI Optical Connector Interface |
| | 81000NI Optical Connector Interface |
| | Optical attenuators: |
| | 81576A Attenuator module (straight SMF) or |
| | 81577A Attenuator module (angled SMF) or |
| | N7761A external Attenuator (1 ch straight SMF) or |
| | N7762A external Attenuator (2 ch straight SMF) or |
| | N7764A external Attenuator (4 ch straight SMF) |
| | N7751A external Attenuator (1 ch with 2 optical power meter channels, SMF) |
| | N7752A external Attenuator (2 ch with 2 optical power meter channels, SMF) |
| | N7766A Optical Attenuator for Multimode Fiber (2ch) |
| | N7768A Optical Attenuator for Multimode Fiber (4ch) |
| DCA-X Oscilloscope | 86100D-ETR/PTB/200/201/300/401 DCA-X mainframe |



| | 86105D-281/IRC Electrical/Optical SMF module or |
|--------------------------|---|
| | 86115D-282 /IRC Dual Optical SMF module |
| | 86107A-020 Precision Time Base (not required, if DCA-X has the option -PTB) |
| | 86115D-282/IRC |
| | Because of their low noise and superior speed, it is recommended to use DCA-M series oscilloscopes instead of DCA-X series oscilloscopes. |
| DCA-M Oscilloscope | N1092A one optical channel or |
| | N1092B two optical channels or |
| | N1092C one optical, two electrical channels or |
| | N1092D four optical channels or |
| | N1092E two optical, two electrical channels |
| | options LOJ/PLK/IRC/200/201/300/401/500 |
| Clock Recovery | N1077A-232/SMS/JSA Optical/Electrical Clock Recovery |
| Software Pre-requisites | Keysight IO Library rev. 18.1 or above |
| | M8070B system software for M8000 series ver. 6.0.100.2 or later and |
| | M8070ADVB Advanced Measurement Package for M8000 series ver. 1.0.59.0 |
| | OR |
| | M8070A system software for M8000 series ver. 5.1.50.2 |
| | N1010A FlexDCA Remote Access System A.06.01.68 or later |
| Application Requirements | Keysight M8070A/B System Software. For the required licenses, see User Guide. |
| | Keysight M8045A with options G32 or G64; 0G3 or UG3; 0G4 or UG4; 801 |
| | Keysight M8046A with options A32 or A64; 801 |
| | Keysight N4917BACA 100G Optical Receiver Test Application. For the required licenses, see User Guide. |
| File Name | SetupM80RxIEEE100G01500003.exe |
| License: | Please see the product data sheet on keysight.com |
| | |



Enhancements

- Support for automated optical stressed receiver sensitivity test for optical transceivers in a CPRI (Option 10) Fronthaul environment in compliance with the following standards:
 - o 100GBASE-LR4 (IEEE 802.3 2015 Clause 88)
 - o 100GBASE-ER4 (IEEE 802.3 2015 Clause 88)
 - CPRI Specification V7.0

The CPRI-Option 10 standard has currently been implemented as an experimental feature only. For more details, get in contact with Keysight support.

- New licensing model. For details, refer to Chapter 2 of the N4917BACA User Guide.
- Support for new reference transmitters:
 - o 81491A-085 and 81491A-135
 - o 81492A-E01
- Support for new M8070B System Software for M8000 Series of BER Test Solutions. This also requires M8070ADVB Advanced Measurement Package for M8000 Series of BERT Test Solutions.
- Support of new firmware versions
 - o M8070B 6.0.100.2
 - M8070ADVB Advanced Measurement Package for M8000 Series 1.0.59.0
 - o M8070A 5.1.50.2
 - o FlexDCA A.06.01.68
- Full support for remote interface
- Improved organization of configuration parameters in logical groups
- Added several new configuration variables in "BERT Settings" to adjust ED and CDR settings for receiver testing.

Note: The new config variable "Jitter Tolerance CDR LBW Auto" is not listed yet in the user guide and remote guide. Use this variable to enable or disable the automatic loop bandwidth adjustment in case a clock data recovery (CDR) is used during jitter tolerance testing.

Fixed defects

- The connection diagrams now show the correct orientation and connection setting for the directional coupler used to combine the data pattern and the sinusoidal interference signal.
- Fixed a defect that caused BER results from the DUT control interface (DCI) to throw an error and abort the receiver test.



- Fixed the behavior of configuration variable "Stressed Eye Calibration Power Mode" setting "Max". The attenuation should be set to OdB now, in case the maximum output power does not exceed the specified abs. max. optical output power (which will limit the power in that case).
- Fixed a defect that caused an error when loading or saving test limit template files.
- Fixed a defect that caused empty entries for some configuration variables.
- Fixed a defect that caused the calibration to abort in some cases when taking a DCA screenshot.
- Fixed a defect that caused all tests to be available even in case of missing instrument connections after loading a saved project.

Known Issues

- Unexpected behavior might be observed when running the software and the software prerequisites on Windows 10 operating system. As a workaround, ensure that you install and run the N4917BACA application and the other software prerequisites as an administrator.
 - In scenarios where the user does not have administrator rights, the suggested workaround is to install the software and prerequisites as an administrator and enable full control (read, write access) **mandatorily** to the following folders:
 - o C:\Program Files\Keysight\M8070A\Apps\N4917BACA
 - o C:\ProgramData\Keysight\M8070A\Apps\N4917BACA
 - C:\ProgramData\Microsoft\Windows\Start Menu\Programs\Keysight M8070A Applications
 - o C:\Users\Public\Documents\Keysight\M8070A\Apps\N4917BACA

and **preferably** to the following additional folders:

- o C:\Users\<user name>\Documents\Keysight\M8070A\Apps\N4917BACA
- o C:\Users\<user_name>\Documents\Keysight\M8070A\Apps\N4917BACA
- When an appended series of calibrations fail during the first trial, the results of successive trials will not be displayed in the *Results* tab even if these calibrations were successful.
 Restart the series in this case or use "Replace results" to overwrite the results of the previous runs.
- Depending on the targeted standard and particular HW configuration, a 6dB or 10dB attenuator might be required in the sinusoidal interference signal path. Use this approach when the calibration fails, and an error related to clipping of AWG amplitude is reported (Error message: *Set range clipped*).
- The TDEC verified by the software and the one displayed in eye-mode measurement of the FlexDCA software using default parameters are based on different OMA definitions, resulting in different TDEC values in presence of strong ISI. The value reported by the N4917BACA software is measured compliant to the method defined in the standards.



- In some of the scenarios that involve the use of an external CDR for transmission standards where its usage is optional, calibrations might lead to failing results.
- Laser safety errors are sometimes returned when the reference transmitter is calibrated, and an external TLS source is used. As a workaround restart the test task or reduce the maximum output power of the tunable laser ("Maximum TLS output Power" parameter in the Configure tab). Alternatively, toggle the "Switch off PG during REFTX recal" parameter in the Configure tab.
- When the Keysight N77xx Viewer software is connected via USB to a N77xx type attenuator which is also used by the N4917BACA application, time-out errors might occur. To prevent these errors during ORST testing, disconnect the N77xx Viewer software from the attenuator.
- In some non-EN-US locales, commas might be the preferred decimal mark instead of the decimal point. Similarly, use of digit group separators might be preferred in some locales. This might lead to misinterpretation of locale-specific formats when working with numeric values. While the N4917BACA application has some validation mechanisms to check for any confusion arising out of the non EN-US formats, it is best to avoid the use of locale-specific formats. Thus, use "point" as the decimal mark and avoid use of digit group separators.

Please contact Keysight Technical Support (www.keysight.com/find/supportrequest) if you encounter any other issue.

Keysight N4917BACA Software Version 01.00.0005

| Release Date | July 19, 2018 |
|---------------------|---|
| Operating System | Microsoft Windows 7 (64 bit) |
| | Microsoft Windows 8 (64 bit) |
| | Microsoft Windows 10 (64 bit) |
| Memory | 8 GB RAM [minimum] |
| Display resolution | WXGA+ (1440 x 900) [minimum] |
| PC Interfaces | USB |
| | LAN |
| | GPIB (optional) |
| Instrument Firmware | M8040A BERT - M8070A System Software |
| | 86100D DCA-M/DCA-X - FlexDCA version A.05.71 or later |
| | 8164B LMS - Ver.V5.25 or later |
| | 81490A Ref Tx - Ver.5.01 or later |
| BERT | M8040A-BU2 mainframe with USB option |



| Signal Generator for Sinusoidal and Gaussian Noise Interference | M8070A-0TP/ONP/1TP/1NP System Software M8045A-G32/0G3/0G4/801 High Performance BERT module M8057A Remote head for M8045A pattern generator, 1 channel M8046A-A32/801 Analyzer module M8195A-002/16G Arbitrary Waveform Generator or M8196A-002 Arbitrary Waveform Generator or 81150A-001 Pulse Function Arbitrary Noise Generator or |
|--|--|
| | 81160A-001 Pulse Function Arbitrary Generator N5171B-503 EXG X-series RF Analog Signal Generator |
| Lightwave Measurement System | 8164B LMS Mainframe Tunable lasers 81602A-013 Tunable Laser 1250-1370 nm or 81606A-113 Tunable Laser 1240-1380 nm or |
| | 81608A-113 Tunable Laser 1240-1380 nm or 81609A-113 Tunable Laser 1240-1380 nm Reference Transmitters |
| | 81490A-E05 Reference Transmitter or 81490A-E09 Reference Transmitter or 81490A-E10 Reference Transmitter (multimode – |
| | for SR only) 81000FI Optical Connector Interface 81000NI Optical Connector Interface |
| | Optical attenuators: 81576A Attenuator module (straight SMF) or 81577A Attenuator module (angled SMF) or N7761A external Attenuator (1 ch straight SMF) or |
| | N7762A external Attenuator (2 ch straight SMF) or N7764A external Attenuator (4 ch straight SMF) N7751A external Attenuator (1 ch with 2 optical power meter channels, SMF) |



| | N7752A external Attenuator (2 ch with 2 optical power meter channels, SMF) |
|--------------------------|--|
| | N7766A Optical Attenuator for Multimode Fiber (2ch) |
| | N7768A Optical Attenuator for Multimode Fiber (4ch) |
| DCA-X Oscilloscope | 86100D-ETR/PTB/200/201/300/401 DCA-X mainframe |
| | 86105D-281/IRC Electrical/Optical SMF module or |
| | 86115D-282 /IRC Dual Optical SMF module |
| | 86107A-020 Precision Time Base (not required, if DCA-X has the option -PTB) 86115D-282/IRC |
| DCA-M Oscilloscope | N1092A one optical channel or |
| 20/ W Goomgoopp | N1092B two optical channels or |
| | N1092C one optical, two electrical channels or |
| | N1092D four optical channels or |
| | N1092E two optical, two electrical channels |
| | options LOJ/PLK/IRC/200/201/300/401/500 |
| Clock Recovery | N1077A-232/SMS/JSA Optical/Electrical Clock Recovery |
| Software Pre-requisites | Keysight IO Library rev. 18.1 or above |
| | M8070A system software for M8000 series Ver. 4.0.100.2 or later |
| | N1010A FlexDCA Remote Access System A.05.71 or later |
| Application Requirements | Keysight M8070A System Software Version: 4.0.100.2 and above with options OTP |
| | Keysight M8045A with options G32 or G64; 0G3 or UG3; 0G4 or UG4; 801 |
| | Keysight M8046A with options A32 or A64; 801 |
| | Keysight N4917BACA 100G Optical Receiver Test Application |
| | N4917BACA-1TP or N4917BACA-1NP |
| File Name | SetupM80RxIEEE100G01000005.exe |
| License: | Please see the product data sheet on keysight.com |
| | |



Features

First release of Keysight N4917BACA 100G Optical Receiver Test Application. The application provides a platform for automated stressed receiver sensitivity test, which is compliant with the following IEEE standards and related Multi Source Agreements (MSA):

- 25GBASE-ER/-LR/-SR
- 100GBASE-LR4/-ER4/-SR4
- CLR4, CWDM4, 4WDM

The solution consists of several test instruments such as a Bit Error Rate Tester (BERT), an arbitrary waveform generator (AWG), Digital Sampling Scope (DCA), Optical Reference Transmitter, Tunable Laser, and Optical Attenuator operating together with the N4917BACA software package.

Some salient features of the N4917BACA 100G Optical Receiver Test Application include:

- Remote control of all the test instrumentation.
- Automated calibration of the optical stressed eye parameters (ER, VECP/SEC, OMA, J2, J4, and J9) following the procedure recommended by IEEE
- Adjustable target values for the above-mentioned metrics
- Automated Stress Receiver Sensitivity, jitter tolerance, and eye mask tests

Known Issues

- Remote Interface feature (View > Preference > Remote) is not officially supported. For instance, "Remote Interface Hint" (right click on "Tests" or "Utility Functions" in Select Tests" Tab) or the reference manual (Help > Automation > Remote Interface) are not final.
- When an appended series of calibrations fail during the first trial, the results of successive trials will not be displayed in the *Results* tab even if these calibrations were successful.
 Restart the series in this case or use "Replace results" to overwrite the results of the previous runs.
- Depending on the targeted standard and particular HW configuration, a 6dB or 10dB attenuator might be required in the sinusoidal interference signal path. Use this approach when the calibration fails, and an error related to clipping of AWG amplitude is reported (Error message: Set range clipped).
- The TDEC verified by the software and the one displayed in eye-mode measurement of the FlexDCA software using default parameters are based on different OMA definitions, resulting in different TDEC values in presence of strong ISI. The value reported by the N4917BACA software is measured compliant to the method defined in the standards.
- The external CDR is not supported for flavors where its usage is optional. Use a clean clock instead (e.g., from pattern generator).



 Laser safety errors are sometimes returned when the reference transmitter is calibrated, and an external TLS source is used. As a workaround restart the test task or reduce the maximum output power of the tunable laser ("Maximum TLS output Power" parameter in the configure tab).

Please contact Keysight Technical Support (www.keysight.com/find/supportrequest) if you encounter any other issue.