



Agilent Medalist i3070 08.30pb Software Patch

Release Notes

Software Release Date : January 2013
System Requirements : Agilent Medalist i3070 test system or
test development workstation
Controller Requirements: Microsoft® Windows® PC
Operating System : Windows 7 or Windows XP
Software Requirement : Agilent Medalist i3070 08.30p

The Agilent Medalist i3070 08.30pb software patch should only be installed on systems with i3070 08.30p software release. It can be installed on systems with i3070 test system software or i3070 development software.

Note the following:

- Installing 08.30pb on a controller with 08.30p will install 08.30pb including 08.30pa.
Uninstalling 08.30pb will bring the system back to 08.30p.
- Installing 08.30pb on a controller with 08.30pa will install 08.30pb.
Uninstalling 08.30pb will bring the system back to 08.30pa.

The 08.30pb software patch addresses the following change requests.

Change Request	Description
CR34245	08.30pa: The Engineer Test Interface is slow to load across a network.
CR34410	08.30pa: On PPU systems, the fixture lock command causes BT-Basic to be unresponsive.
CR34401	08.20p: The software outputs incorrect content when executing testplans with nested function calls.
CR34388	07.20pc: Board or Fixture Graphics in BT-Basic shows xtgrabkeyboard warnings and occasionally freezes.

Microsoft and Windows are registered trademarks or trademarks of Microsoft Corporation in the United States and/or other countries.

Change Request	Description
CR34408	08.20p: Calculations of inductor impedance are sandwiched between parallel caps in .discharge file in IPG.
CR34409	08.20p: Calculations of harmful voltage for capacitors when $V < 1$ in .discharge file in IPG.
CR34400	08.20p: Pushbutton Debug error when auto-debugging TestJet tests on panel boards.
CR34372/ CR34371	08.30: Pushbutton Q-STATS freezes if the failure report has more than one page.
CR34365/ CR34392	08.30: STOP button in Operator Interface fails but PPU credit is deducted.
CR34391	08.30: DGN Test 8 incorrectly appears for ASRU cards for Mux systems.

Installing the 08.30pb Software Patch

This software patch must be installed using the administrator login (or a login with administrator privileges).

Follow these steps to install the 08.30pb software patch:

- 1 Save the **Agilenti3070_0830pb.exe** file to your hard disk.
- 2 Close all open programs.
- 3 Double-click **Agilenti3070_0830pb.exe**.
- 4 Follow the on-screen instructions for installation.
- 5 To validate that the software was installed correctly:
 - a On the **Start** menu, select **Programs > Agilent ICT > Korn Shell**.
 - b In the Korn Shell window, type `version` and press **Enter**.

The following software revision should be displayed:
Agilent Medalist i3070 08.30pb 0612 WN

© Agilent Technologies, Inc. 2013
Printed in Malaysia 01/13



E9901-90031