



Agilent Technologies

Agilent Medalist i3070 08.00pa Software Package

Software Release Date: January, 2010

System Requirements: Agilent Medalist i3070 or Test Development PC

Controller Requirements: Windows PC

Operating System: Microsoft Windows XP

Software Requirement: Agilent Medalist i3070 08.00p

This Software Patch may be installed only on MS Windows systems with i3070 08.00p software release. It can be installed on systems with i3070 Series 5 Test System Software or i3070 Series 5 Development Software.

The Software Update must be installed by the administrator login (or a login with administrator privileges).

To download and install the 08.00pa Software Update on Windows systems running the i3070 08.00p software release:

1. Click on "i3070 08.00pa 1009 WN" Download. Save the Agilenti3070_08.00pa.exe file to disk.
2. Close all open programs.
3. Go to the directory in which the file was saved and Double-click on Agilenti3070_08.00pa.exe.
4. Follow the Install Shield instructions for installation.
5. On the menu bar, click START then click Programs then click Agilent ICT then click Korn Shell. In the Korn Shell window, type "version" and press Enter. The software revision "Patch i3070 08.00pa 1009 WN" should display at the end of the output.
6. Delete the Agilenti3070_08.00pa.exe.

Agilent Medalist i3070 08.00pa Software Release Bulletin

This is a Software Patch for Agilent Medalist i3070 08.00p for Windows.

You must already have version i3070 08.00p on your computer before you install the 08.00pa software patch.

Software patch 08.00pa addresses these issues:

Change Request Identification	Description
CR33702	Fixture Power Supplies Turn-Off if running Push Button Debug marco has been solved.
CR33739	Not able to load external device after "xdunload" command issue has been fixed.
CR33740	Internal error -11 no longer occurred when "xdload" command executed if external device DLL is in board\custom_ext_dev folder
CR33802	Detector timing problem when mod 2 has less pin cards than mod 3 has been solved. Diagnostics tests affected are 4250 and 2310.
CR33804	Diagnostics test 2743 replaced by test 2749 for ASRU N revision card. Test 2743 still remains for ASRU C revision card.