



Agilent Medalist i3070 07.10pd Software Package

Software Release Date: December, 2008

System Requirements: Agilent Medalist i3070 or Test Development PC

Controller Requirements: Windows PC

Operating System: Microsoft Windows XP

Software Requirement: Agilent Medalist i3070 07.10p

Patch Requirement: NA

This Software Patch may be installed only on MS Windows systems with i3070 07.10p software release. It can be installed on systems with i3070 Test System Software or i3070 Development Software.

The installer will automatically check for 07.10sa, 07.10sb and 07.10pc patches and automatically uninstall them if they are present in the system.

The Software Update must be installed by the administrator login (or a login with administrator privileges).

To install the 07.10pd Software Patch on Windows systems running the i3070 software:

1. Save Agilenti3070_07.10pd.exe file to disk.
2. Close all open programs.
3. Go to the directory in which the file was saved and Double-click on Agilenti3070_07.10pd.exe.
4. Follow the Install Shield instructions for installation.
5. To validate that the software installed correctly, bring up a Korn Shell window. On the menu bar, click START then click Programs then click Agilent ICT then click Korn Shell. In the Korn Shell window, type version and return. The software revision "Agilent Medalist i3070 07.10pd 1107 WN "should display at the end of the output.
6. Delete the Agilenti3070_07.10pd.exe.

Agilent Medalist i3070 07.10pd Software Release Bulletin

This is a Software Patch for Agilent Medalist i3070 07.10p for Windows.

You must already have version i3070 **07.10p** on your computer before you install the 07.10pd software patch.

Software patch 07.10pd includes all fixes in 07.10sa, 07.10sb and 07.10pc.

Software patch 07.10pd also addresses these issues:

Change Request Identification	Description
CR28688	Coverage Analyst includes iVTEP and NPM pins in the report.
CR31644	07.00p: DUT Power Supply HP6634A is not recognized.
CR31711	07.10p: Mixed tests using trigger are unable to execute correctly.
CR32022	07.10pc: "Pascal System Error 8" was encountered when running Board Test Grader.
CR32234	07.00p: btbasic commands "sps" and "dps" are slower than previous releases.
CR32304	Coverage Analyst: Cannot process if comments exist in analog test source file.
CR32363	Error "R752 Failure returned by scheduled program" is generated when a 1149.6 aio test is compiled.
CR32464	07.10p: "Internal Error -11" was encountered when Worst Probe Report is enabled for non-panelized board.